


2008 FORD E-SERIES TAIL LIGHT CIRCUIT *HIGH PRIORITY SAFETY ISSUE*

In January 2009 we began receiving reports of Taillights either inoperative or flickering on 2008 E-Series vehicles.

Customers are to report this symptom directly to Ford at 1-800-34-FLEET.

After locating this in a new chassis prior to any ambulance conversion AEV directs customers to inspect a Ford Motor Company harness located under the driver side threshold. Multiple Customer Technicians have reported corrosion in the FMC Taillight circuitry. A Ford Brown Wire shows to have excessive corrosion inside the FMC harness at a two into one pressed splice connector. Effected truck owners need to make a report to 800-34-FLEET then contact FMC Dealer for repair (See picture attached).

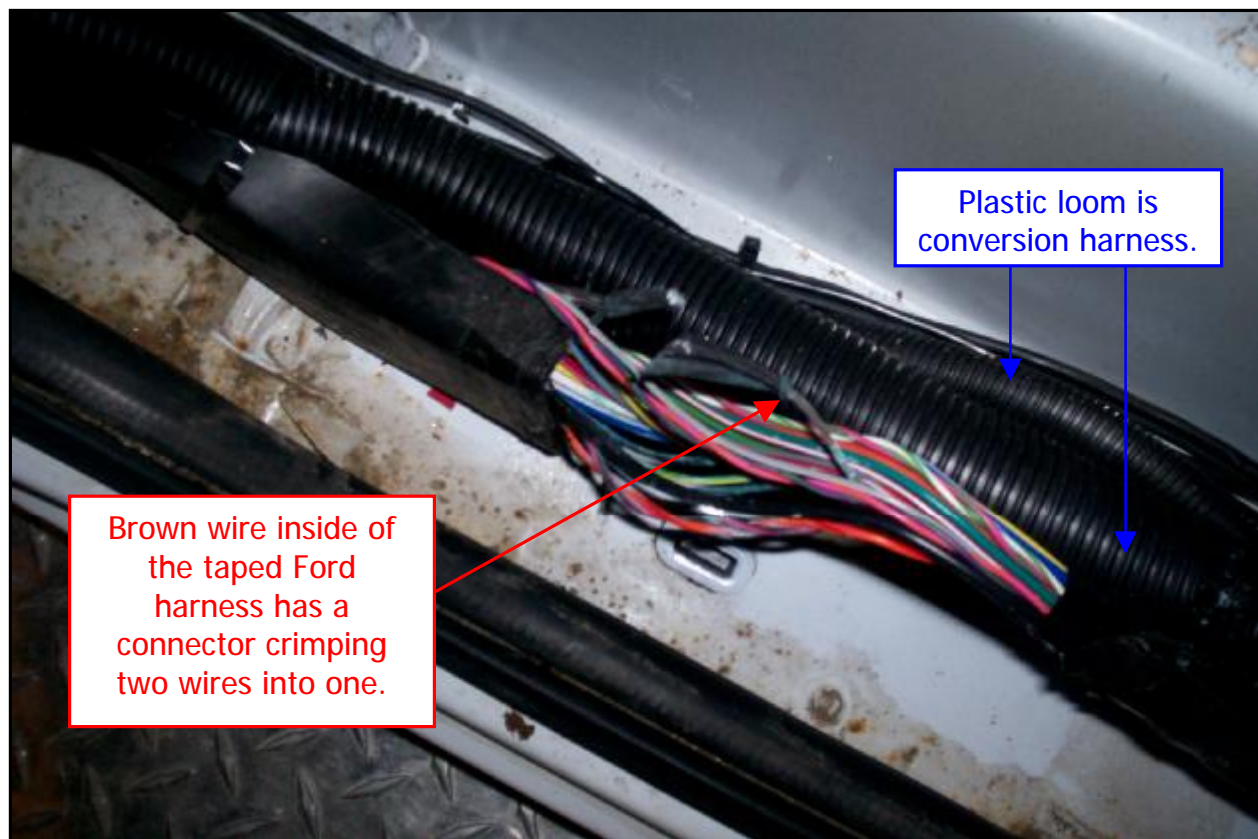

AEV has forwarded this information to The Ford Motor Company.

Dominick Gaetano Jr. / AEV Warranty / 800.374.9749 x250 / www.AEV.com